

NOTICE

Weight and balance or operating limitation changes shall be entered in the appropriate aircraft record. An alteration must be compatible with all previous alterations to assure continued conformity with the applicable airworthiness requirements.

B. DESCRIPTION OF WORK ACCOMPLISHED (If more space is required, attach additional sheets. Identify with aircraft nationality and registration mark and date work completed.)

Replaced, existing seatbelts with Rupert Industries model 65-51 seatbelts, attaching to existing seatbelt attach hardware.

Installed two sets of American Safety Shoulder Harnesses PIN 501690-401-2251. Harnesses attached to extruded aluminum corner brace attached to structure between rear windows. Brace attached using AN 4-12 bolts, AN 365 nuts, and 2"x4" piece of ¹⁰⁹⁰aluminum for a doubler. Harnesses attached to brace by AN 3-8 bolts, AN 970-3 washers and AN365 nuts.

Installation done in accordance with AC4313-2a chapter 9.

ADDITIONAL SHEETS ARE ATTACHED